


BLIND FLANGE PN40
СЛЕПА ПРИРАБНИЦА PN40




NPS	Flange				Screws			Form B	Form B
	D	b	k	d _{9 max.}	Number	Thread	d ₂	kg	kg
10	90	16	60		4	M 12	14	0,72	
15	95	16	65		4	M 12	14	0,81	
20	105	18	75		4	M 12	14	1,24	
25	115	18	85		4	M 12	14	1,38	
32	140	18	100		4	M 16	18	2,03	
40	150	18	110		4	M 16	18	2,35	
50	165	20	125		4	M 16	18	3,2	
65	185	22	145	55	8	M 16	18	4,29	4,33
80	200	24	160	70	8	M 16	18	5,88	5,94
100	235	24	190	90	8	M 20	22	7,54	7,64
125	270	26	220	115	8	M 24	26	10,80	11
150	300	28	250	140	8	M 24	26	14,5	14,7
175	350	32	295	165	12	M 27	30	22,1	22,4
200	375	34	320	190	12	M 27	30	27,2	27,6
250	450	38	385	235	12	M 30	33	43,8	44,5
300	515	42	450	285	16	M 30	33	63,3	64,3
350	580	46	510	330	16	M 33	36	89,5	90,8
400	660	50	585	380	16	M 36	39	127	129
500	755	56	670	475	20	M 39	42	172	175

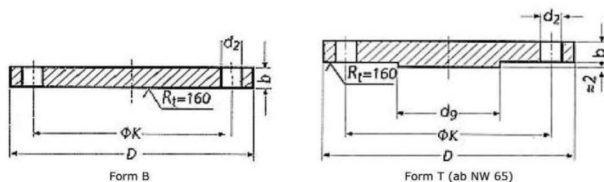

EN 1092-1-05

СЛЕПА ПРИРАБНИЦА
PN64
BLIND FLANGE PN64

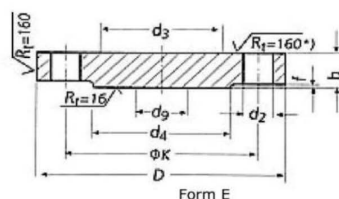

NPS	Flange							Screws			kg
	D	b	k	d ₃	d ₄	d _{9 max.}	f	Number	Thread	d ₂	
10	100	20	70	32	40	-	2	4	M 12	14	1
15	105	20	75	34	45	-	2	4	M 12	14	1,22
25	140	24	100	52	68	-	2	4	M 16	18	2,65
32	155	24	110	62	78	-	2	4	M 20	22	3,24
40	170	26	125	70	88	-	3	4	M 20	22	4,09
50	180	26	135	82	102	-	3	4	M 20	22	4,51
65	205	26	160	98	122	45	3	8	M 20	22	5,71
80	215	28	170	112	138	60	3	8	M 20	22	6,92
100	250	30	200	138	162	80	3	8	M 24	26	10,1
125	295	34	240	168	188	105	3	8	M 27	30	16
150	345	36	280	202	218	130	3	8	M 30	33	23,5
175	375	40	310	228	260	155	3	12	M 30	33	30,8
200	415	42	345	256	285	180	3	12	M 33	36	39,7
250	470	46	400	316	345	220	3	12	M 33	36	57,4
300	530	52	460	372	410	270	4	16	M 33	36	81
350	600	56	525	420	465	310	4	16	M 36	39	114
400	670	60	585	475	535	360	4	16	M 39	42	153